

CASE STUDY: White Concrete

Site: Private home, Clifton beach, Tasmania


For a family of two adults, two children and a large dog.

Flooring: Original slab contained white oxide, burnished and treated with the Kunos white oil in April 2008.

Maintenance: Floor was washed occasionally with the Trena neutral cleaner.

Rejuvenation and Repair: Battery acid had leaked onto the floor penetrating the surface and creating a dull patch.

November 2012, 3 Years since initial oiling.

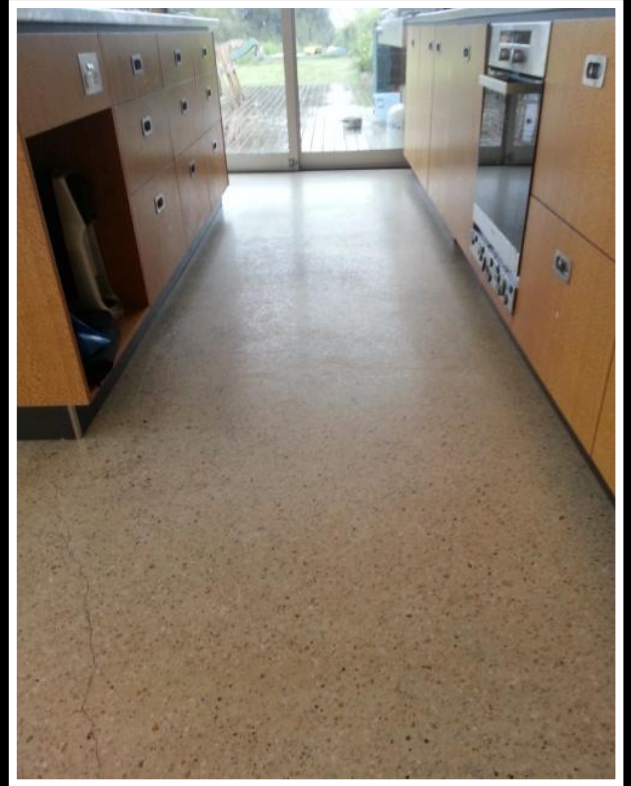


Apply a small amount of the oil originally used directly on the surface, in this case Kunos white



For repairs, work oil in with a fine sand paper over the damaged area



Allow the oil to be absorbed for approx 15 minutes, and then wipe off completely

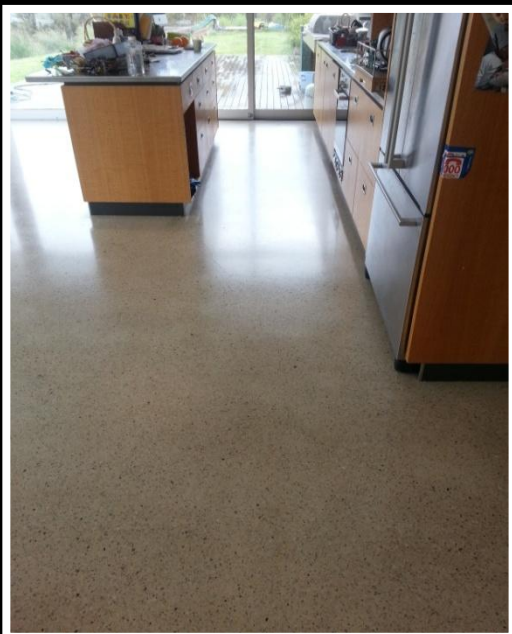

After repaired and rejuvenated

The whole process required 2.5 hours,

0.5 litres of oil, one orbital disc and one white pad.

Heavy furniture did not need to be removed and the area can be used the next day.